

FRONTGRADE

APPLICATION NOTE

Frontgrade UT8QNF8M8 64Mb QCOTS Nor Flash

1/24/2025 Version #:1.0.1



Overview

The application note intends to inform users of a possible rare anomalous device programming event which may impact performance and data retention. This application note specifically targets applications utilizing infrequent Nor Flash programming such as boot and FPGA or microcontroller configuration code for high reliability systems. Frontgrade recommends instituting the additional 'Program Verify' routine for all such applications to assure optimal data retention performance.

This application note is only applicable to the titled Frontgrade 64Mb Nor Flash product UT8QNF8M8 (SMD# 5962-12204 all device types) and no other current or future Frontgrade non-volatile memory products.

Background

The aforementioned Frontgrade QCOTS (Quantified Commercial Off-The-Shelf) product offering is manufactured utilizing a onetime purchase of a single commercial die source. Frontgrade intends this one time purchase to meet the needs of the entire product life cycle. The die source was originally acquired from Spansion Inc. Since that time, Spansion Inc. was acquired by Cypress Semiconductor who subsequently was acquired and is currently operated by Infineon Technologies. The following Cypress Semiconductor embedded application note is provided by Frontgrade with permission of Infineon Technologies.



Embedded Cypress Application Note



AN98548

Double Programming for High Reliability Systems

Author: Ken Perdue

AN98548 provides additional information on Cypress's approach to mitigating Pseudo Single Bit Charge Loss (pSBCL).

1 Abstract

Cypress ships Floating Gate Flash Memory to many market segments through out the world. Automotive, Aerospace, and other Markets are typically willing to make appropriate changes and investments to improve system reliability.

This document is intended to be used as an internal application note which supports an earlier Cypress Application Note: "Mitigating Pseudo Single Bit Charge Loss". The supplemental information includes real implementation experiences at multiple Automotive Customers, relevant data from Cypress's CCARs Group, Marketing's long term proposed support for our customers, and real customer expectation and questions.

The goal of this application note is to provide the user information that supports the following items:

- Cypress sees pSBCL as a customer application induced failure and not a device related failure.
- The occurrence of Pseudo Signal Bit Charge Loss (pSBCL) is a rare phenomenon resulting in a very low ppm failure rate which typically means only customers with strong quality goals to eliminate re-occurrence of all identified failures will be interested in implementing the recommended corrective action.

2 Pseudo SBCL Definition and Prevention

2.1 Defining pSBCL

A Single Bit Charge Loss (SBCL) cell is a defective memory cell which exhibits electron leakage. The electron leakage from the floating gate can be accelerated with voltage or high temperature stress. The subject cell does not have good data retention which is equal to defective bit. The Cypress CCAR has standard processes to characterize and identify defective SBCL cells.

A pSBCL cell is a physically good memory bit which had only been marginally programmed. The cell has no physical anomalies and does not exhibit electron leakage from the floating gate with voltage or high temperature stress. The subject cell has good data retention which is equal to good bit.

The follow characterizes the differences in the behavior and identification of SBCL & pSBCL cells.

 Initial Analysis of true SBCL & pSBCL appear very similar; the subject SBCL & pSBCL are depleted compared to a known good programmed cell.



Note after standard Electrical and Thermal Stress Testing there are differences in the cell charge levels.

www.cypress.com

Document No. 001-98548 Rev. *B

1




Double Programming for High Reliability Systems

2.2.3 Preventing pSBCL Flip Bits

Instituting an additional Program Verify routine immediately after the programming operation can insure the all bits were programmed to the targeted threshold voltage.

The second Program Verify function can be accomplished by modifying the Flash Software drivers to replace typical "Read Verify" after "Programming Completed" with more stringent "Program Verify" as shown in Figure 1. By re-executing the "Write Program Command", "Program Verify" is leveraged which provides insurance against marginal programmed bits that could lead to a flipped bit or Pseudo-SBCL event. This change results in minimal overhead for the Flash programming process with any marginally programmed bit(s) being detected and programmed automatically. This process ensures quality of programmed bits in a very efficient manner.

Figure 1. Double Programming Algorithm

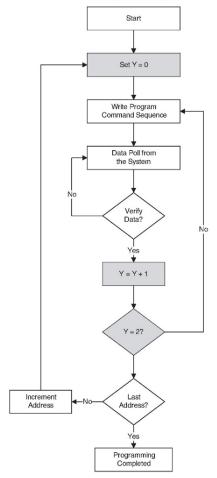

www.cypress.com

Document No. 001-98548 Rev. *B





Double Programming for High Reliability Systems

6. The IDS currents at those locations were then recorded for the respective sectors on each device.

3.3 Sample Customer Questions

Question 1

The Cypress applications note "Preventing Pseudo SBCL" shows a flow chart in Figure 1 with added yellow blocks for their proposed containment. The yellow blocks are to add a second "Program Verify". Why doesn't the first "Program Verify" in the flow catch the weakly charged bit if the threshold is set higher during a "Program Verify"?

Cypress Reply

If there is noise or transient present during the first Program Verify the Program Reference Level can be corrupted or shifted by the subject noise or transient. Under these conditions the subject Cell Charge Level is verified with using an invalid Program Reference Level resulting in a marginally programmed cell.

Reference Section 3.2:

Possible cause for marginal programmed bit, also known as 'soft-programmed cell'

Presence of system noise or transients during programming operation can lead to 'under-programming'

High noise levels could limit the programming voltage from reaching the required levels to strongly program cells

Reading a marginal program bit can be a '0' or a '1'

Follow up to Question 1

Is this is a probabilistic phenomenon?

Cypress Reply

Yes

Question 2

Based on what is being said here; it is theoretically possible that even double programming could result in us having the same issue however the probably is very low (e.g. <<< 1ppm).

Cypress Reply

Yes

Question 3

Is the flow chart in . Double Programming Algorithm on page 3 without the yellow blocks the same as the normal programming flow call out in the data sheet?

Cypress Reply

Yes

4 References

Cypress Application Note: "Mitigating Psuedo_SBCL" May 2006
Cypress CCAR Groups: Standard CCAR Flow Process Document





Double Programming for High Reliability Systems

3 Double Programming implementation

pSBCL is not a device related failure but an application induced failure that is a rare phenomenon resulting in a very low ppm failure rate. Give this low occurrence of pSBCL, there are many customers who are not willing to implementing the recommended corrective action "Double Programming". The target customers are those who have strong quality goals to eliminate re-occurrence of an identified failure mode.

3.1 Psuedo SBCL Failure Rates and Corrective Action Effectiveness

At the time of this writing Cypress knows of only two customers in the Automotive Market who have implemented double programming. The first customer has a very demanding application and end customer. The application was a Transmission Control Unit with application temperature requirements ups to 145C. The OEM's end customer place high demands on the OEM to eliminate all identified failures.

Cypress CCAR performed database analysis on the returns from the subject TCU program to understand the effectiveness of implementing "Double Programming" to mitigate pSBCL failures. The CCAR database analysis was partitioned into two segments. Below are the pSBCL failure rates on this particular program prior to implementing "Double Programming" and the analysis showing the new failure rate after implementing "Double Programming".

- Standard single pass programming: ~6.7ppm (Production: Two Years=> 750K units)
- "Double Programming" Algorithm: 0 ppm (Production Six month => 400K units)

This customer has realized significant reduction in pSBCL failures by implementing Cypress's recommended best practice "Double Programming" corrective actions.

3.2 Typical Customer Expectation and Questions

Each customer and potentially each program at a customer which implements "Double Programming" will have unique requirements. The following is intended to highlight specific tasks that were required prior to or during the implementation of the "Double Programming" algorithm. It is key to clarify for the Customer the differences between pSBCL & SBCL and the new "Double Programming" algorithm. (See *Pseudo_SBCL Definition and Prevention* on page 1.)

Below is a collection of items the customer might request during "Double Programming Implementation."

Double Programming Overhead

Customer will request Cypress provide information concerning the additional over head associated with Double Programming. There are estimates that the additional over is approximately 20%, obviously the customer must run the new algorithms on their products to obtain a concise answer.

2. Where are Code Updates required

Once implementation begins the customers program may requires the software algorithms to be updated in any or all of the following areas:

- a. Module Code Updates.
- b. Software Tools used update code.
- c. Flash Programmer Algorithm Updates. Cypress personnel must work with Programmer Mfg to update the subject algorithm(s).
- 3. Verifying Double Programming Works

Some customer(s) will require that Cypress provide verification that the new Software Algorithm does fully charge a marginally programmed cell:

Below is one methodology used to generate marginally programmed cells.

- 1. Identified 'Programmed bits' in each sector of the customer pattern and recorded the BP address locations.
- 2. Programmed a 'dummy' unit at those BP address locations and read the unit on the Nextest tester.
- 3. Recorded the Nextest address locations. (Different than BP addresses.)
- The customer pattern was modified so that the identified bits could be programmed into a 'Weakly'
 programmed state.
- 5. Each identified cell was pulsed on the Nextest tester to put the units into a weakly programmed state.

Document No. 001-98548 Rev. *B





Double Programming for High Reliability Systems

Document History Page

Document Title: AN98548 - Double Programming for High Reliability Systems Document Number: 001-98548								
Rev.	ECN No.	Orig. of Change	Submission Date	Description of Change				
**	-	-	10/22/2007	Initial version				
*A	4978554	MSWI	10/21/2015	Updated in Cypress template				
*B	5843240	AESATMP8	08/03/2017	Updated logo and Copyright.				





Double Programming for High Reliability Systems

Worldwide Sales and Design Support

Cypress maintains a worldwide network of offices, solution centers, manufacturer's representatives, and distributors. To find the office closest to you, visit us at Cypress Locations.

Products

ARM® Cortex® Microcontrollers cypress.com/arm cypress.com/automotive Clocks & Buffers cypress.com/clocks Interface cypress.com/interface Internet of Things cypress.com/iot Memory cypress.com/memory Microcontrollers cypress.com/mcu **PSoC** cypress.com/psoc Power Management ICs cypress.com/pmic

Touch Sensing cypress.com/touch
USB Controllers cypress.com/usb
Wireless Connectivity cypress.com/wireless

PSoC[®] Solutions

PSoC 1 | PSoC 3 | PSoC 4 | PSoC 5LP | PSoC 6

Cypress Developer Community

Forums | WICED IOT Forums | Projects | Video | Blogs | Training | Components

Technical Support

cypress.com/support

All other trademarks or registered trademarks referenced herein are the property of their respective owners



Cypress Semiconductor 198 Champion Court San Jose, CA 95134-1709

© Cypress Semiconductor Corporation, 2007-2017. This document is the property of Cypress Semiconductor Corporation and its subsidiaries, including Spansion LLC ("Cypress"). This document, including any software or firmware included or referenced in this document ("Software"), is owned by Cypress under the intellectual property laws and treaties of the United States and other countries worldwide. Cypress reserves all rights under such laws and treaties and does not, except as specifically stated in this paragraph, grant any license under its patents, copyrights, trademarks, or other intellectual property rights. If the Software is not accompanied by a license agreement and you do not otherwise have a written agreement with Cypress governing the use of the Software, then Cypress hereby grants you a personal, non-exclusive, nontransferable license (without the right to sublicense) (1s) under its copyright rights in the Software (a) for Software provided in source code form, to modify and reproduce the Software solely for use with Cypress hardware products, only internally within your organization, and (b) to distribute the Software in binary code form externally to end users (either directly or indirectly through resellers and distributors), solely for use on Cypress hardware product units, and (2) under those claims of Cypress's patents that are infringed by the Software (as provided by Cypress, unmodified) to make, use, distribute, and import the Software solely for use with Cypress hardware products. Any other use, reproduction, modification, translation, or compilation of the Software is prohibited.

TO THE EXTENT PERMITTED BY APPLICABLE LAW, CYPRESS MAKES NO WARRANTY OF ANY KIND, EXPRESS OR IMPLIED, WITH REGARD TO THIS DOCUMENT OR ANY SOFTWARE OR ACCOMPANYING HARDWARE, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE. To the extent permitted by applicable law, Cypress reserves the right to make changes to this document without further notice. Cypress does not assume any liability arising out of the application or use of any product or circuit described in this document. Any information provided in this document, including any sample design information or programming code, is provided only or reference purposes. It is the responsibility of the user of this document to properly design, program, and test the functionality and safety of any application made of this information and any resulting product. Cypress products are not designed, intended, or authorized for use as critical components in systems designed or intended for the operation of weapons, weapons systems, nuclear installations, life-support devices or systems, other medical devices or systems (including resuscitation equipment and surgical implants), pollution control or hazardous substances management, or other uses where the failure of the device or system could cause personal injury, death, or properly damage ("Unintended Uses"). A critical component is any component of a device or system whose failure to perform can be reasonably expected to cause the failure of the device or system, or to affect its safety or effectiveness. Cypress is not liable, in whole or in part, and you shall and hereby do release Cypress from any claim, damage, or other liability arising from or related to all Unintended Uses of Cypress products. You shall indemnify and hold Cypress harmless from and against all claims, costs, damages, and other liabilities, including claims for personal injury or death, arising from or related to all Unintended Uses of Cypress products.

Cypress, the Cypress logo, Spansion, the Spansion logo, and combinations thereof, WICED, PSoC, CapSense, EZ-USB, F-RAM, and Traveo are trademarks or registered trademarks of Cypress in the United States and other countries. For a more complete list of Cypress trademarks, visit cypress.com. Other names and brands may be claimed as property of their respective owners.

www.cypress.com

Document No. 001-98548 Rev. *B

7



Revision History

Date	Revision #	Author	Change Description	Page #
04/16/2022	1.0.0	MJL	Initial Release	
01/24/2025	1.0.1	MJL	Converted to FG format and verified embedded Infineon app note is current revision.	

Frontgrade Technologies Proprietary Information Frontgrade Technologies (Frontgrade or Company) reserves the right to make changes to any products and services described herein at any time without notice. Consult a Frontgrade sales representative to verify that the information contained herein is current before using the product described herein. Frontgrade does not assume any responsibility or liability arising out of the application or use of any product or service described herein, except as expressly agreed to in writing by the Company; nor does the purchase, lease, or use of a product or service convey a license to any patents rights, copyrights, trademark rights, or any other intellectual property rights of the Company or any third party.